

- **機械式微差壓錶**是利用簡單、無摩擦的磁體螺旋運動以橡膠膜片作為敏感元件而進行測量工作的彈性壓力錶，它能利用指標迅速指示出被測氣體的壓力。無論是正壓、負壓或差壓，此設計具有防震、搖動和過壓的功能，而且錶內無需充注液體，也就沒有氣化、凍結，異味的問題出現
- **差壓錶**被廣泛應用於測量風扇和鼓風機的壓力，篩檢程式阻力、風速、爐壓、孔板差壓，同時也用於燃燒過程中的空氣煤氣比值控制及自動閥控制，以及醫療保健設備中的血壓和呼吸壓力監測



選用型號規格

DJ-5 **代碼1** 壓力範圍

碼1	(inch)		
000-00N+..	.05-0-.2	020	0-20
000-00+..	0-.25	025	0-25
000-0+.	0-.50	030	0-30
001	0-1.0	040	0-40
002	0-2.0	050	0-50
003	0-3.0	060	0-60
004	0-4.0	080	0-80
005	0-5.0	100	0-100
006	0-6.0	120	0-120
008	0-8.0	150	0-150
010	0-10	160	0-160
012	0-12	180	0-180
015	0-15	250	0-250

DJ-52 代碼1 壓力範圍

碼	1 (PSI)
01	0-1
02	0-2
03	0-3
04	0-4
05	0-5
10*	0-10
15*	0-15
20*	0-20
30**	0-30

DJ-5000- **代碼1** 壓力範圍

碼 1	(mm)		(cm)		(Pa)		(kPa)
6MM+..	0-6	15CM	0-15	60NPA+.	10-0-50	0.5KPA	0-0.5
10MM+.	0-10	20CM	0-20	60PA+..	0-60	1KPA	0-1
15MM	0-15	25CM	0-25	100PA+.	0-100	1.5KPA	0-1.5
25MM	0-25	50CM	0-50	125PA+.	0-125	2KPA	0-2
30MM	0-30	80CM	0-80	250PA	0-250	2.5KPA	0-2.5
50MM	0-50	100CM	0-100	300PA	0-300	3KPA	0-3
80MM	0-80	150CM	0-150	500PA	0-500	4KPA	0-4
100MM	0-100	200CM	0-200	750PA	0-750	5KPA	0-5
125MM	0-125	250CM	0-250	1000PA	0-100x10	8KPA	0-8
150MM	0-150	300CM	0-300			10KPA	0-10
200MM	0-200					15KPA	0-15
250MM	0-250					20KPA	0-20
300MM	0-300					25KPA	0-25
						30KPA	0-30


DJ-53 代碼1 壓力範圍
以零為中心

碼1	(inch)
00-00+..	0.125-0-0.125
00-0+.	.25-0-.25
01	.5-0-.5
02	1-0-1
04	2-0-2
10	5-0-5
20	10-0-10
30	15-0-15


DJ-5300- 代碼1 壓力範圍以零為中心

碼1	(mm)		(cm)		(Pa)		(kPa)
6MM+..	3-0-3	4CM	2-0-2		60PA+..	30-0-30	1KPA .5-0-.5
10MM+.	5-0-5	10CM	5-0-5		100PA+.	50-0-50	2KPA 1-0-1
20MM+.	10-0-10	30CM	15-0-15		120PA	60-0-60	2.5KPA 1.25-0-1.25
			..Accuracy +/-3%		200PA	100-0-100	3KPA 1.5-0-1.5
			..Accuracy +/-4%		250PA	125-0-125	
					300PA	150-0-150	
					500PA	250-0-250	
					1000PA	500-0-500	



尺寸圖與配件

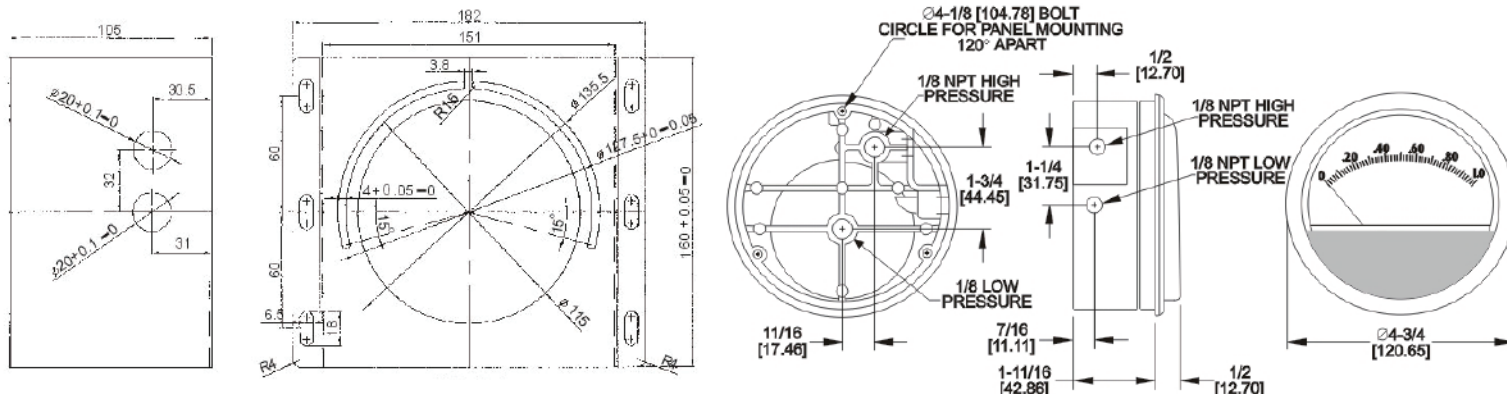


●標配

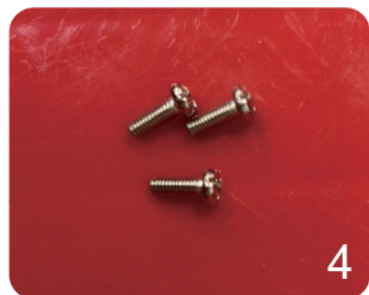


●選配

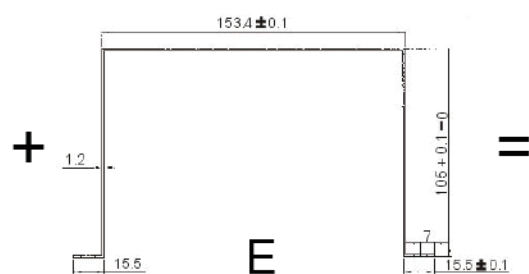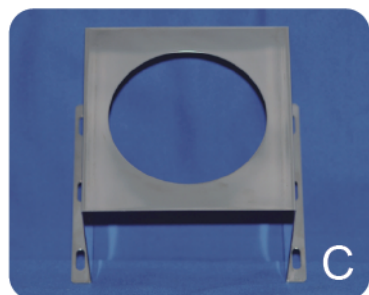

選配一: (Model: D4D6A)

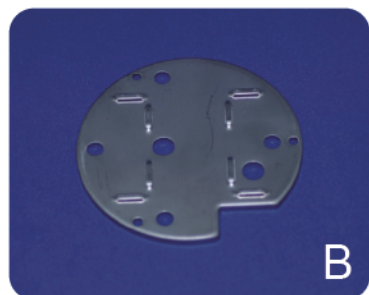

選配二: B (Model: D4E6A)

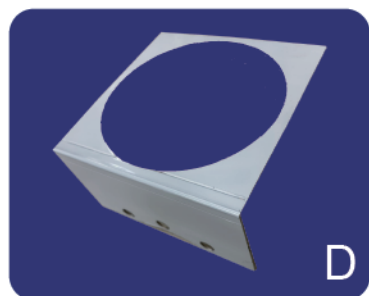

選配三: D (Model: D4D8A)